

Измерительные датчики лазерного смещения PDB

Технические характеристики

По вопросам продаж и поддержки обращайтесь:

Алматы (727)345-47-04
Ангарск (3955)60-70-56
Архангельск (8182)63-90-72
Астрахань (8512)99-46-04
Барнаул (3852)73-04-60
Белгород (4722)40-23-64
Благовещенск (4162)22-76-07
Брянск (4832)59-03-52
Владивосток (423)249-28-31
Владикавказ (8672)28-90-48
Владимир (4922)49-43-18
Волгоград (844)278-03-48
Вологда (8172)26-41-59
Воронеж (473)204-51-73
Екатеринбург (343)384-55-89

Иваново (4932)77-34-06
Ижевск (3412)26-03-58
Иркутск (395)279-98-46
Казань (843)206-01-48
Калининград (4012)72-03-81
Калуга (4842)92-23-67
Кемерово (3842)65-04-62
Киров (8332)68-02-04
Коломна (4966)23-41-49
Кострома (4942)77-07-48
Краснодар (861)203-40-90
Красноярск (391)204-63-61
Курск (4712)77-13-04
Курган (3522)50-90-47
Липецк (4742)52-20-81

Магнитогорск (3519)55-03-13
Москва (495)268-04-70
Мурманск (8152)59-64-93
Набережные Челны (8552)20-53-41
Нижний Новгород (831)429-08-12
Новокузнецк (3843)20-46-81
Ноябрьск (3496)41-32-12
Новосибирск (383)227-86-73
Омск (3812)21-46-40
Орел (4862)44-53-42
Оренбург (3532)37-68-04
Пенза (8412)22-31-16
Петрозаводск (8142)55-98-37
Псков (8112)59-10-37
Пермь (342)205-81-47

Ростов-на-Дону (863)308-18-15
Рязань (4912)46-61-64
Самара (846)206-03-16
Санкт-Петербург (812)309-46-40
Саратов (845)249-38-78
Севастополь (8692)22-31-93
Саранск (8342)22-96-24
Симферополь (3652)67-13-56
Смоленск (4812)29-41-54
Сочи (862)225-72-31
Ставрополь (8652)20-65-13
Сургут (3462)77-98-35
Сыктывкар (8212)25-95-17
Тамбов (4752)50-40-97
Тверь (4822)63-31-35

Тольятти (8482)63-91-07
Томск (3822)98-41-53
Тула (4872)33-79-87
Тюмень (3452)66-21-18
Ульяновск (8422)24-23-59
Улан-Удэ (3012)59-97-51
Уфа (347)229-48-12
Хабаровск (4212)92-98-04
Чебоксары (8352)28-53-07
Челябинск (351)202-03-61
Череповец (8202)49-02-64
Чита (3022)38-34-83
Якутск (4112)23-90-97
Ярославль (4852)69-52-93

Россия +7(495)268-04-70

Казахстан +(727)345-47-04

Беларусь +(375)257-127-884

Узбекистан +998(71)205-18-59

Киргизия +996(312)96-26-47

эл.почта: ahj@nt-rt.ru || сайт: <https://lanbao.nt-rt.ru/>

Laser displacement sensor PDB series



Feature description

- Exquisite appearance and light plastic housing, easy to mount and dismount
- Only by pressing Long and short combination of two keys S, T to complete all function settings fastly
- 0.5mm diameter light spot to accurately measure very tiny objects
- Key or remote teach-in to easily set response time for different applications
- Powerful function setting and flexible output way
- Complete shielded design, stronger anti-interference performance
- IP67 protection degree, able to work in water or dusty environment



Model specification

RS-485	PDB-CR50DGR	4...20mA	PDB-CR50TGI
--------	-------------	----------	-------------

Specifications

Center distance	50mm	Display	OLED Display(size:14*10.7mm)
Measuring range	±15mm	Temperature drift	±0.02%F.S./°C
Full scale(F.S.)	30mm	Indicator	Power indicator:Green LED;Action indicator:Yellow LED
Supply voltage	RS-485:10...30VDC;4...20mA:12...24VDC		Alarm indicator:Yellow LED
Consumption power	≤700mW	Protection circuit④	Short circuit,reverse polarity,overload protection
Load current	200mA	Built-in function⑤	Slave address & Port rate setting;Zero setting;Parameter query
Voltage drop	<2.5V		Product self-check;Output setting;Average setting
Light source	Red laser(650nm);Laser level:Class 2		Single point teach;Window teach;Restore factory settings
Light spot	Φ0.5mm@50mm	Service environment	Operation temperature:-10...+50°C
Resolution	10um@50mm		Storage temperature:-20...+70°C
Linear accuracy①②	RS-485:±0.3%F.S.;4...20mA:±0.4%F.S.		Ambient temperature:35...85%RH(No condensation)
Repeat accuracy①②③	20um	Anti ambient light	Incandescent light: < 3,000lux
Output1	RS-485(Support Modbus protocol)	Protection degree	IP67
	4...20mA(Load resistance < 390Ω)	Material	Housing:ABS;Lens cover:PMMA
Output2	PUSH-PULL/NPN/PNP And NO/NC Settable	Vibration resistance	10...55Hz Double amplitude1mm,2H each in X,Y,Z directions
Distance setting	RS-485:Keypress/RS-485 setting	Impulse resistance	500m/s ² (About 50G) 3 times each in X,Y,Z directions
	4...20mA:Keypress setting	Connection way	RS-485:2m 5pins PVC cable;4...20mA:2m 4pins PVC cable
Response time	2ms/16ms/40ms Settable	Accessory	Screw(M4×35mm)×2、Nut×2、Washer×2、Mounting bracket、Operation manual
Dimension	65*51*23mm		

Remark:

①Test conditions:Standard data at 23 ± 5 °C ;Supply voltage 24VDC;30 minutes' warmup before test;Sampling period 2ms;Average sampling times 100;Standard sensing object 90% white card

②The statistical data follows the 3σ criteria


③Repeat accuracy:23 ± 5 °C environment,90% reflectivity white card,100 test data results

④Slave address,baud rate setting only for RS-485 series


⑤Protection circuit only for switch output

⑥Product operation steps and precautions in "Operation manual"


Dimension

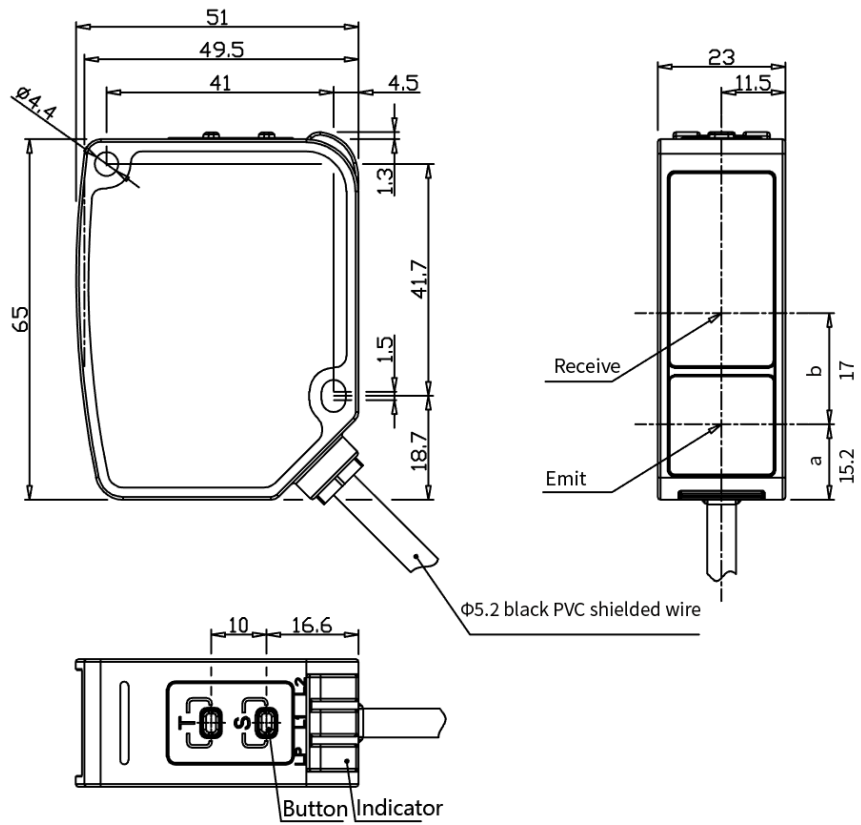

Wiring diagram

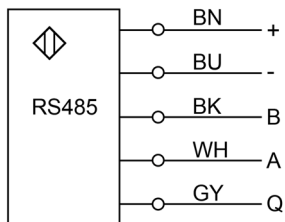

Serial communication RS-485

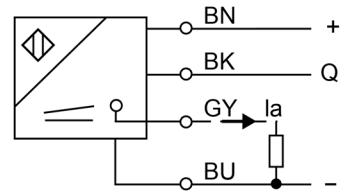

Analog output 4...20mA

Remark:
The sensors are equipped with shielded cables, Q is the switch output.

Digital display laser displacement sensor PDB series



Feature description

- Exquisite appearance and light plastic housing, easy to mount and dismount
- Convenient operation panel with visualized OLED display to complete all function settings fastly
- 0.5mm diameter light spot to accurately measure very tiny objects.
- Key or remote teach-in to easily set response time for different applications
- Powerful function setting and flexible output way
- Complete shielded design, stronger anti-interference performance
- IP67 protection degree, able to work in water or dusty environment



Model specification

RS-485	PDB-CR50DGR	4...20mA	PDB-CR50TGI
--------	-------------	----------	-------------

Specifications

Center distance	50mm	Display	OLED Display(size:14*10.7mm)
Measuring range	±15mm	Temperature drift	±0.02%F.S./°C
Full scale(F.S.)	30mm	Indicator	Power indicator:Green LED;Action indicator:Yellow LED
Supply voltage	RS-485:10...30VDC;4...20mA:12...24VDC		Alarm indicator:Yellow LED
Consumption power	≤700mW	Protection circuit④	Short circuit,reverse polarity,overload protection
Load current	200mA	Built-in function⑤	Slave address & Baud rate setting;Zero set;Product self-check;Output setting
Voltage drop	<2.5V		Analog map settings;Parameter query;Single point teach
Light source	Red laser(650nm);Laser level:Class 2		Window teach;Restore factory settings
Light spot	Φ0.5mm@50mm	Service environment	Operation temperature:-10...+50°C
Resolution	10um@50mm		Storage temperature:-20...+70°C
Linear accuracy①②	RS-485:±0.3%F.S.;4...20mA:±0.4%F.S.		Ambient temperature:35...85%RH(No condensation)
Repeat accuracy①②③	20um	Anti ambient light	Incandescent light: < 3,000lux
Output1	RS-485(Support Modbus protocol)	Protection degree	IP67
	4...20mA(Load resistance < 390Ω)	Material	Housing:plastic ABS;Lens cover:PMMA;Display panel:PC
Output2	PUSH-PULL/NPN/PNP And NO/NC Settable	Vibration resistance	10...55Hz Double amplitude1mm,2H each in X,Y,Z directions
Distance setting	RS-485:Keypress/RS-485 setting	Impulse resistance	500m/s ² (About 50G)3 times each in X,Y,Z directions
	4...20mA:Keypress setting	Connection way	RS-485:2m 5pins PVC cable;4...20mA:2m 4pins PVC cable
Response time	2ms/16ms/40ms Settable	Accessory	Screw(M4×35mm)×2、Nut×2、Washer×2、Mounting bracket、Operation manual
Dimension	65*51*23mm		

Remark:

①Test conditions:Standard data at 23 ± 5 °C ;Supply voltage 24VDC;30 minutes' warmup before test;Sampling period 2ms;Average sampling times 100;Standard sensing object 90% white card

②The statistical data follows the 3σ criteria


③Repeat accuracy:23 ± 5 °C environment,90% reflectivity white card,100 test data results

④Slave address,baud rate setting only for RS-485 series


⑤Protection circuit only for switch output

⑥Product operation steps and precautions in "Operation manual"


Dimension

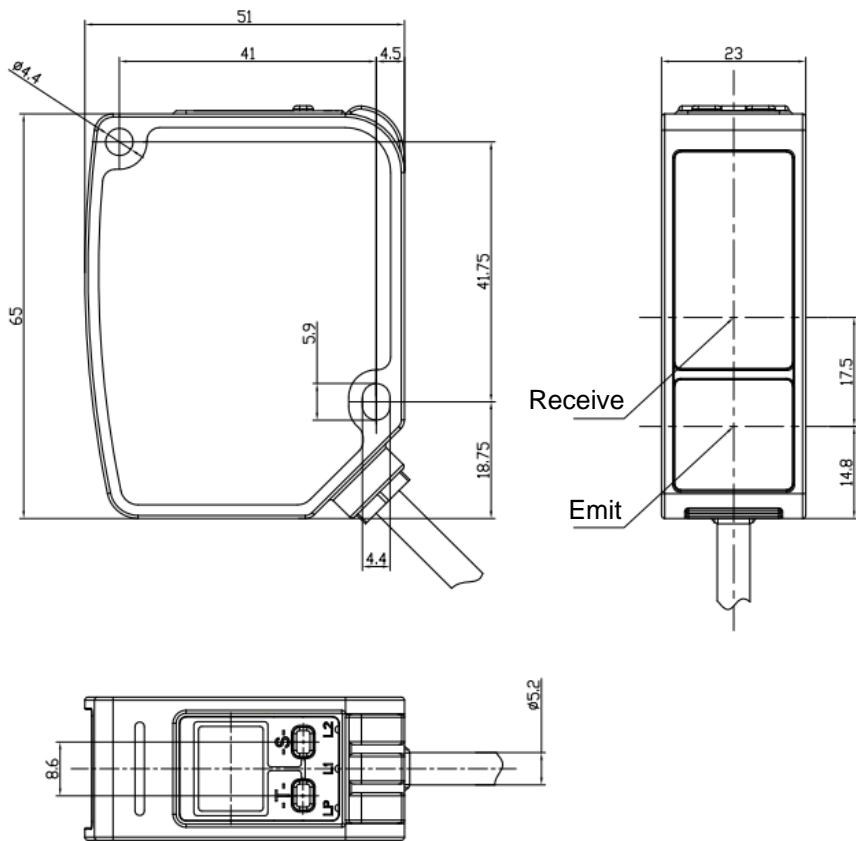

Wiring diagram

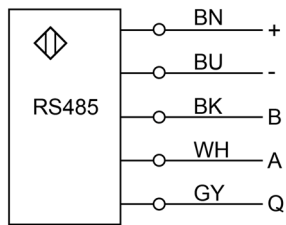

Serial communication RS-485

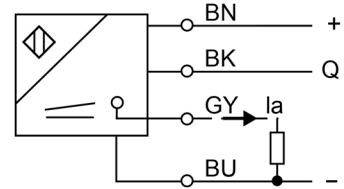

Analog output 4...20mA

Remark:
The sensors are equipped with shielded cables, Q is the switch output.

Digital display laser displacement sensor PDB series



Feature description

- Exquisite appearance and light plastic housing, easy to mount and dismount
- Convenient operation panel with visualized OLED display to complete all function settings fastly
- 0.5mm diameter light spot to accurately measure very tiny objects
- Key or remote teach-in to easily set response time for different applications
- Powerful function setting and flexible output way
- Complete shielded design, stronger anti-interference performance
- IP67 protection degree, able to work in water or dusty environment



Model specification

RS-485	PDB-CR30DGR	4...20mA	PDB-CR30TGI
--------	-------------	----------	-------------

Specifications

Center distance	30mm	Display	OLED Display(size:14*10.7mm)
Measuring range	±5mm	Temperature drift	±0.08%F.S./°C
Full scale(F.S.)	10mm	Indicator	Power indicator:Green LED;Action indicator:Yellow LED
Supply voltage	RS-485:10...30VDC;4...20mA:12...24VDC		Alarm indicator:Yellow LED
Consumption power	≤700mW	Protection circuit④	Short circuit,reverse polarity,overload protection
Load current	200mA	Built-in function⑤	Slave address & Baud rate setting;Zero set;Product self-check;Output setting
Voltage drop	<2.5V		Analog map settings;Parameter query;Single point teach
Light source	Red laser(650nm);Laser level:Class 2		Window teach;Restore factory settings
Light spot	Φ0.5mm@30mm	Service environment	Operation temperature:-10...+50°C
Resolution	2.5um@30mm		Storage temperature:-20...+70°C
Linear accuracy①②	RS-485:±0.3%F.S.;4...20mA:±0.4%F.S.		Ambient temperature:35...85%RH(No condensation)
Repeat accuracy①②③	5um	Anti ambient light	Incandescent light: < 3,000lux
Output1	RS-485(Support Modbus protocol)	Protection degree	IP67
	4...20mA(Load resistance < 390Ω)	Material	Housing:Plastic ABS;Lens cover:PMMA ;Display panel: PC
Output2	PUSH-PULL/NPN/PNP And NO/NC Settable	Vibration resistance	10...55Hz Double amplitude1mm,2H each in X,Y,Z directions
Distance setting	RS-485:Keypress/RS-485 setting	Impulse resistance	500m/s ² (About 50G)3 times each in X,Y,Z directions
	4...20mA:Keypress setting	Connection way	RS-485:2m 5pins PVC cable;4...20mA:2m 4pins PVC cable
Response time	2ms/16ms/40ms Settable	Accessory	Screw(M4×35mm)×2, Nut×2, Washer×2, Mounting bracket, Operation manual
Dimension	65*51*23mm		

Remark:

①Test conditions:Standard data at 23 ± 5 °C ;Supply voltage 24VDC;30 minutes' warmup before test;Sampling period 2ms;Average sampling times 100;Standard sensing object 90% white card

②The statistical data follows the 3σ criteria


③Repeat accuracy:23 ± 5 °C environment,90% reflectivity white card,100 test data results

④Slave address,baud rate setting only for RS-485 series


⑤Protection circuit only for switch output

⑥Product operation steps and precautions in "Operation manual"


Dimension

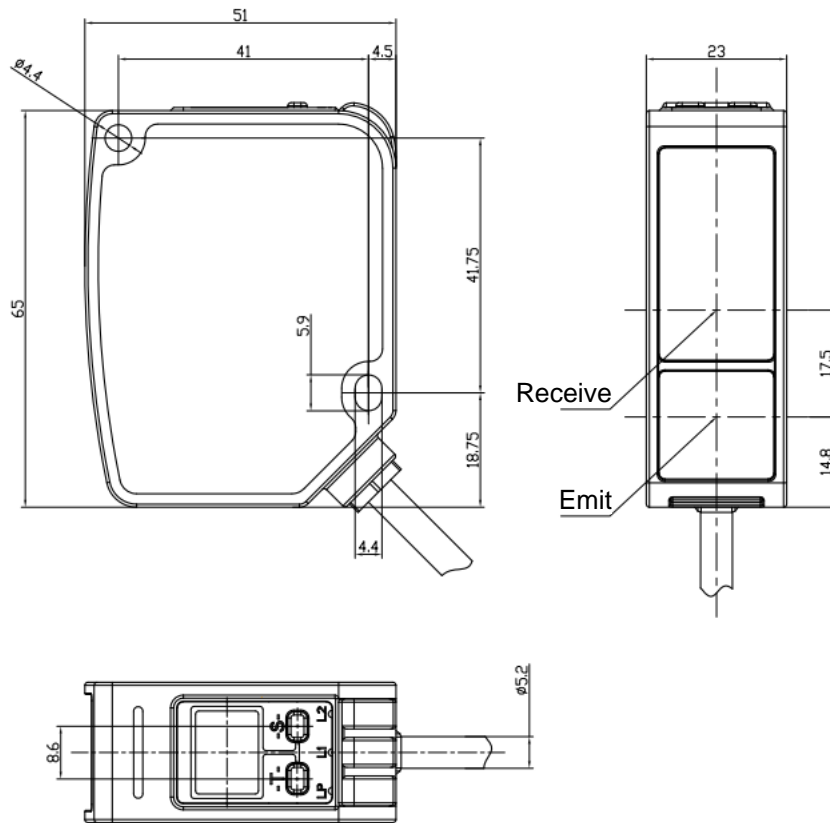

Wiring diagram

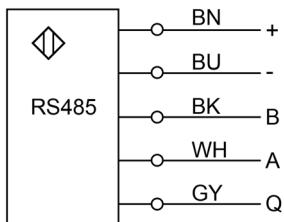

Serial communication RS-485

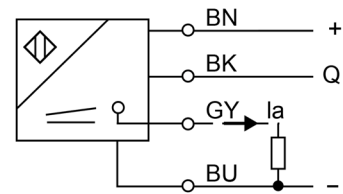

Analog output 4...20mA

Remark:
The sensors are equipped with shielded cables, Q is the switch output.

Laser displacement sensor PDB series



Feature description

- Exquisite appearance and light plastic housing, easy to mount and dismount
- Only by pressing Long and short combination of two keys S, T to complete all function settings fastly
- 0.5mm diameter light spot to accurately measure very tiny objects
- Key or remote teach-in to easily set response time for different applications
- Powerful function setting and flexible output way
- Complete shielded design, stronger anti-interference performance
- IP67 protection degree, able to work in water or dusty environment



Model specification

RS-485	PDB-CR50DGR	4...20mA	PDB-CR50TGI
--------	-------------	----------	-------------

Specifications

Center distance	50mm	Display	OLED Display(size:14*10.7mm)
Measuring range	±15mm	Temperature drift	±0.02%F.S./°C
Full scale(F.S.)	30mm	Indicator	Power indicator:Green LED;Action indicator:Yellow LED
Supply voltage	RS-485:10...30VDC;4...20mA:12...24VDC		Alarm indicator:Yellow LED
Consumption power	≤700mW	Protection circuit④	Short circuit,reverse polarity,overload protection
Load current	200mA	Built-in function⑤	Slave address & Port rate setting;Zero setting;Parameter query
Voltage drop	<2.5V		Product self-check;Output setting;Average setting
Light source	Red laser(650nm);Laser level:Class 2		Single point teach;Window teach;Restore factory settings
Light spot	Φ0.5mm@50mm	Service environment	Operation temperature:-10...+50°C
Resolution	10um@50mm		Storage temperature:-20...+70°C
Linear accuracy①②	RS-485:±0.3%F.S.;4...20mA:±0.4%F.S.		Ambient temperature:35...85%RH(No condensation)
Repeat accuracy①②③	20um	Anti ambient light	Incandescent light: < 3,000lux
Output1	RS-485(Support Modbus protocol)	Protection degree	IP67
	4...20mA(Load resistance < 390Ω)	Material	Housing:ABS;Lens cover:PMMA
Output2	PUSH-PULL/NPN/PNP And NO/NC Settable	Vibration resistance	10...55Hz Double amplitude1mm,2H each in X,Y,Z directions
Distance setting	RS-485:Keypress/RS-485 setting	Impulse resistance	500m/s ² (About 50G) 3 times each in X,Y,Z directions
	4...20mA:Keypress setting	Connection way	RS-485:2m 5pins PVC cable;4...20mA:2m 4pins PVC cable
Response time	2ms/16ms/40ms Settable	Accessory	Screw(M4×35mm)×2、Nut×2、Washer×2、Mounting bracket、Operation manual
Dimension	65*51*23mm		

Remark:

①Test conditions:Standard data at 23 ± 5 °C ;Supply voltage 24VDC;30 minutes' warmup before test;Sampling period 2ms;Average sampling times 100;Standard sensing object 90% white card

②The statistical data follows the 3σ criteria


③Repeat accuracy:23 ± 5 °C environment,90% reflectivity white card,100 test data results

④Slave address,baud rate setting only for RS-485 series


⑤Protection circuit only for switch output

⑥Product operation steps and precautions in "Operation manual"


Dimension

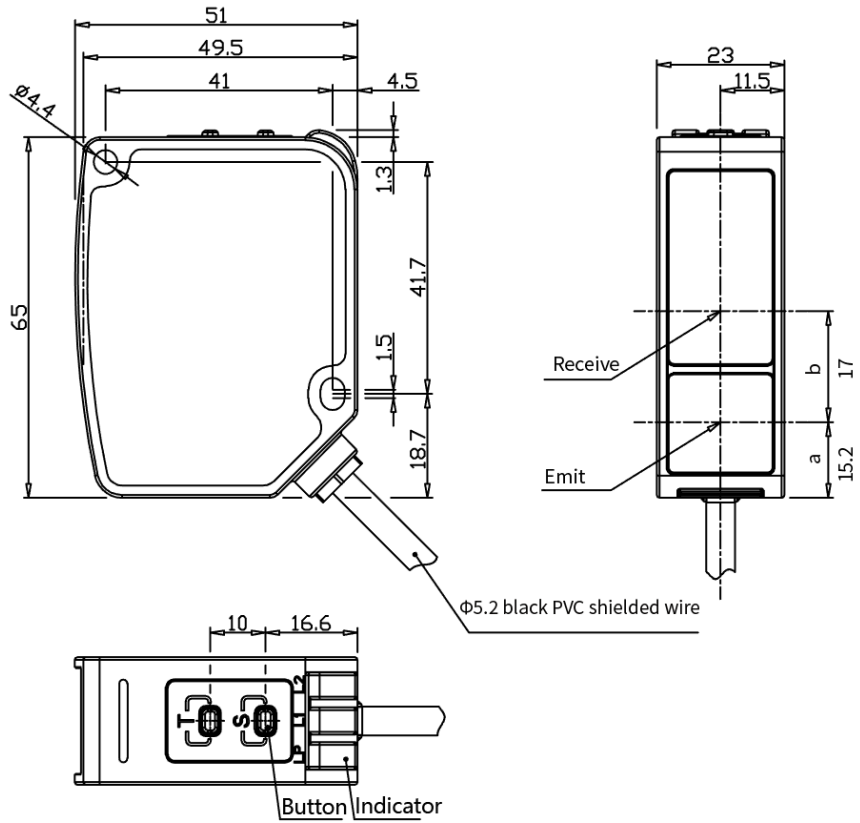

Wiring diagram

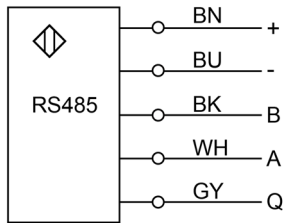

Serial communication RS-485

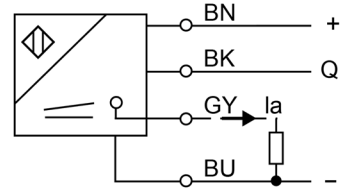

Analog output 4...20mA

Remark:
The sensors are equipped with shielded cables, Q is the switch output.

По вопросам продаж и поддержки обращайтесь:

Алматы (727)345-47-04
Ангарск (3955)60-70-56
Архангельск (8182)63-90-72
Астрахань (8512)99-46-04
Барнаул (3852)73-04-60
Белгород (4722)40-23-64
Благовещенск (4162)22-76-07
Брянск (4832)59-03-52
Владивосток (423)249-28-31
Владикавказ (8672)28-90-48
Владимир (4922)49-43-18
Волгоград (844)278-03-48
Вологда (8172)26-41-59
Воронеж (473)204-51-73
Екатеринбург (343)384-55-89

Иваново (4932)77-34-06
Ижевск (3412)26-03-58
Иркутск (395)279-98-46
Казань (843)206-01-48
Калининград (4012)72-03-81
Калуга (4842)92-23-67
Кемерово (3842)65-04-62
Киров (8332)68-02-04
Коломна (4966)23-41-49
Кострома (4942)77-07-48
Краснодар (861)203-40-90
Красноярск (391)204-63-61
Курск (4712)77-13-04
Курган (3522)50-90-47
Липецк (4742)52-20-81

Магнитогорск (3519)55-03-13
Москва (495)268-04-70
Мурманск (8152)59-64-93
Набережные Челны (8552)20-53-41
Новокузнецк (3843)20-46-81
Ноябрьск (3496)41-32-12
Новосибирск (383)227-86-73
Омск (3812)21-46-40
Орел (4862)44-53-42
Оренбург (3532)37-68-04
Пенза (8412)22-31-16
Петрозаводск (8142)55-98-37
Псков (8112)59-10-37
Пермь (342)205-81-47

Ростов-на-Дону (863)308-18-15
Рязань (4912)46-61-64
Самара (846)206-03-16
Санкт-Петербург (812)309-46-40
Саратов (845)249-38-78
Севастополь (8692)22-31-93
Саранск (8342)22-96-24
Симферополь (3652)67-13-56
Смоленск (4812)29-41-54
Сочи (862)225-72-31
Ставрополь (8652)20-65-13
Сургут (3462)77-98-35
Сыктывкар (8212)25-95-17
Тамбов (4752)50-40-97
Тверь (4822)63-31-35

Тольятти (8482)63-91-07
Томск (3822)98-41-53
Тула (4872)33-79-87
Тюмень (3452)66-21-18
Ульяновск (8422)24-23-59
Улан-Удэ (3012)59-97-51
Уфа (347)229-48-12
Хабаровск (4212)92-98-04
Чебоксары (8352)28-53-07
Челябинск (351)202-03-61
Череповец (8202)49-02-64
Чита (3022)38-34-83
Якутск (4112)23-90-97
Ярославль (4852)69-52-93

Россия +7(495)268-04-70

Казахстан +(727)345-47-04

Беларусь +(375)257-127-884

Узбекистан +998(71)205-18-59

Киргизия +996(312)96-26-47

эл.почта: ahj@nt-rt.ru || сайт: <https://lanbao.nt-rt.ru/>